



MANDRINI PER MASCHIARE A CAMBIO RAPIDO CON SPOSTAMENTO RADIALE E COMPENSAZIONE ASSIALE A PRESSIONE - TRAZIONE

QUICK CHANGE TAPERING SPINDLES WITH TRACTION AND PRESSURE AXIAL COMPENSATION PLUS PARALLEL MOTIO TO AXIS

MANDRINS DE TARAUDAGE À CHANGEMENT RAPIDE AVEC COMPENSATION LONGITUDINALE EN PRESSION ET TRACTION ET DISPOSITIF DE FLOTTEMENT PARALLELE À L'AXE

PORTA MACHOS DE CAMBIO RAPIDO CON COMPENSACION A PRECION - TRACCION Y FLOTANTE


Dimensioni in mm.

SPOSTAM. RADIALE	
Mandr. A	0,25
Mandr. B	0,5
Mandr. C	1
Mandr. D	1,5
Mandr. 32	0,5
Mandr. 40	0,75

Attacco Tr.

Attacco CM.

Attacco B.

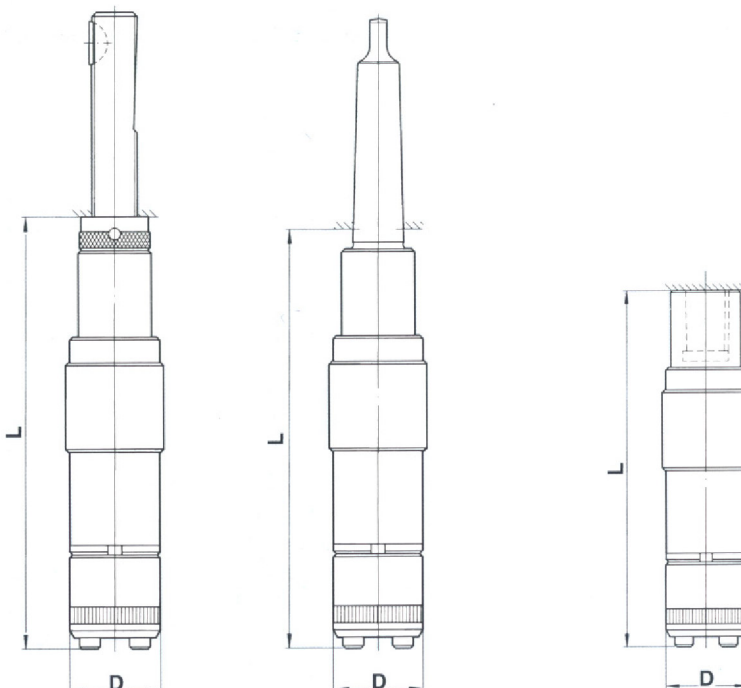

Esempio di ordinazione:						MA0-2K-Tr. 20				MA0-2K-CM.2				MA0-2K-B12					
Tipo di mandrino	Campo di Filett.	D	Mont. Buss. Tipo	Compen. assiale		L				L				L					
				Press.	Traz.	Tr. 16	Tr. 20	Tr. 28	Tr. 36	CM.1	CM.2	CM.3	CM.4	B.10	B.12	B.16	B.18	B.22	B.24
MA0-1K	M 1÷10	23	A	25	5	143	143			138	139			154	158				
MA0-2K				20	10	138	138			133	134			149	153				
MA0-3K				15	15	133	133			128	129			144	148				
MA0-4K				0	30	118	118			113	114			129	133				
MA1-1K	M 6÷12	35	B	35	5	168	168	168		163	164	164				185	198		
MA1-2K				30	10	163	163	163		158	158	159				180	193		
MA1-3K				20	20	153	153	153		148	149	149				170	183		
MA1-4K				0	40	133	133	133		128	129	129				150	163		
MA2-1K	M 10÷20	50	C	35	5		201	201	203		198	198	199				229	238	
MA2-2K				30	10		196	196	198		193	193	194				224	233	
MA2-3K				20	20		186	186	188		183	183	184				214	223	
MA2-4K				0	40		166	166	168		163	163	164				194	203	
MA3-1K	M 16÷33	72	D	35	5			257	259			254	255					291	301
MA3-2K				30	10			252	254			249	250					286	296
MA3-3K				20	20			242	244			239	240					276	286
MA3-4K				0	40			222	224			219	220					256	266
MA32-30K	M 3÷12	32	B	30	10	163	163			158	159								
MA32-20K				20	20	153	153			148	149								
MA32-0K				0	40	133	133			128	129								
MA40-30K	M 6÷18	40	40	30	10		189	189			186	186							
MA40-20K				20	20		179	179			176	176							
MA40-0K				0	40		159	159			156	156							