



MANDRINI PER MASCHIARE A CAMBIO RAPIDO CON SPOSTAMENTO RADIALE E COMPENSAZIONE ASSIALE A PRESSIONE

QUICK CHANGE TAPERING SPINDLES WITH PRESSURE AXIAL COMPENSATION
PRESSURE AND PARALLEL MOTIO TO AXIS

MANDRINS DE TARAUDAGE À CHANGEMENT RAPIDE AVEC COMPENSATION AXIALE
EN PRESSION ET DISPOSITIF DE FLOTTEMENT PARALLELE À L'AXE

PORTA MACHOS DE CAMBIO RAPIDO CON COMPENSACION A PRECION Y FLOTANTE


Dimensioni in mm.

SPOSTAM. RADIALE	
Mandr. A	0,25
Mandr. B	0,5
Mandr. C	1
Mandr. D	1,5
Mandr. 32	0,5
Mandr. 40	0,75

Attacco Tr.

Attacco CM.

Attacco B.

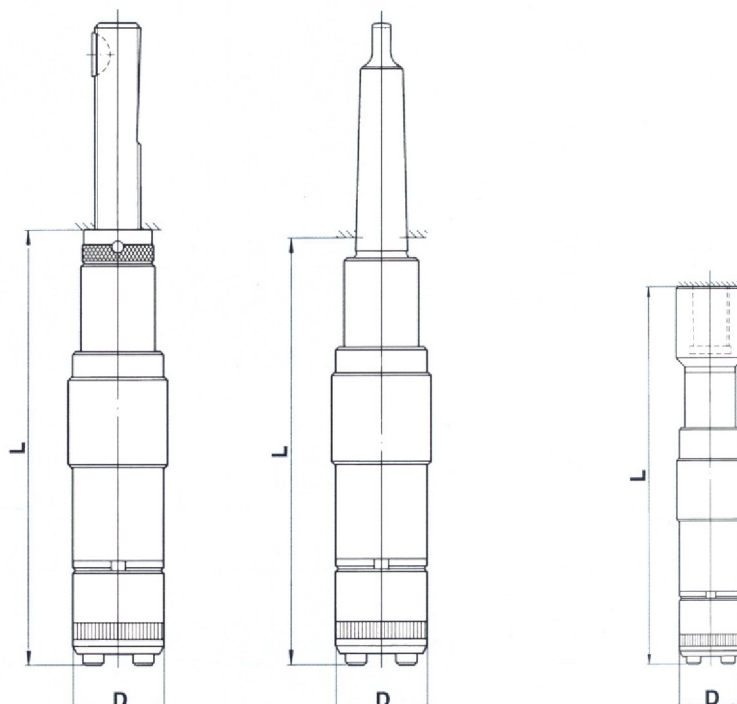

Esempio di ordinazione:					MA0-2-Tr. 20				MA0-2-CM. 2				MA0-2-B12					
Tipo di mandrino	Campo di Filett.	D	Mont. Buss. Tipo	Compen. assiale a Press.	L				L				L					
					Tr. 16	Tr. 20	Tr. 28	Tr. 36	CM.1	CM.2	CM.3	CM.4	B.10	B.12	B.16	B.18	B.22	B.24
MA0-1	M 1÷10	23	A	10	109	109			103	104			119	125				
MA0-2				15	119	119			113	114			129	133				
MA0-3				20	129	129			123	124			139	143				
MA0-4				25	139	139			133	134			149	153				
MA0-5				30	149	149			143	144			159	163				
MA1-1	M 6÷12	35	B	15	124	124	124		118	119	119			112	118	127		
MA1-2				20	134	134	134		128	129	129			122	122	137		
MA1-3				25	144	144	144		138	139	139			132	132	147		
MA1-4				30	154	154	154		148	149	149			142	142	157		
MA1-5				40	174	174	174		168	169	169			162	162	177		
MA2-1	M 10÷20	50	C	18		164	164	166							152	152	168	
MA2-2				25		178	178	180		173	173	174			166	166	182	
MA2-3				30		188	188	190		183	183	184			176	176	192	
MA2-4				40		208	208	210		203	203	204			196	196	212	
MA3-1	M 16÷33	72	D	25			234	236			229	230					224	224
MA3-2				30			244	246			239	240					232	232
MA3-3				40			264	266			259	260					252	252
MA32-40	M 3÷12	32	B	40	174	174			168	169								
MA40-40	M 6÷18	40	40	40		201	201			196	196							